



1

Fixing of the check card functions coral and sapphire

→ Starting from serial number: 13001734 dated 14/05/13

0812-20 R04 for coral 65

S0812-20 R04 for coral 70s



0612-10 R04 for sapphire 65-85


S0612-10 R04 for sapphire 70s-85s

The pressure couplers have been replaced (63705003, pos. 18).

We have verified that, the pressure couplers did not assure the correct fixing of the check card functions for a long time, creating some problems while pressing the buttons on the control panel. These couplers have been replaced by hexagonal spacers.

The new spacers can be sent as spare parts for the machines already produced, as long as they are sent complete with the washer (pos. 21) and the nut (pos. 22).

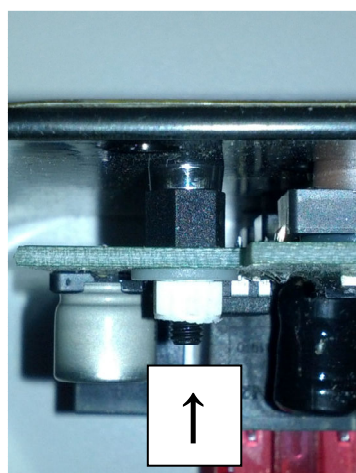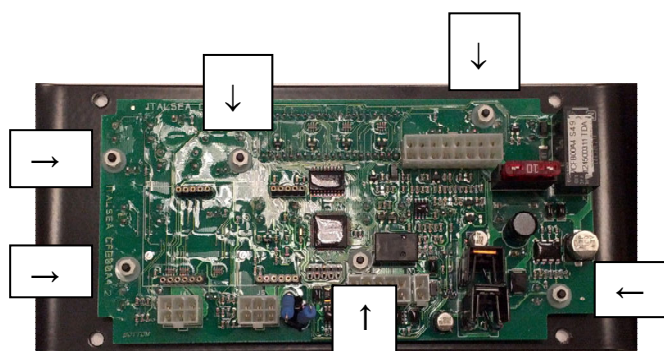

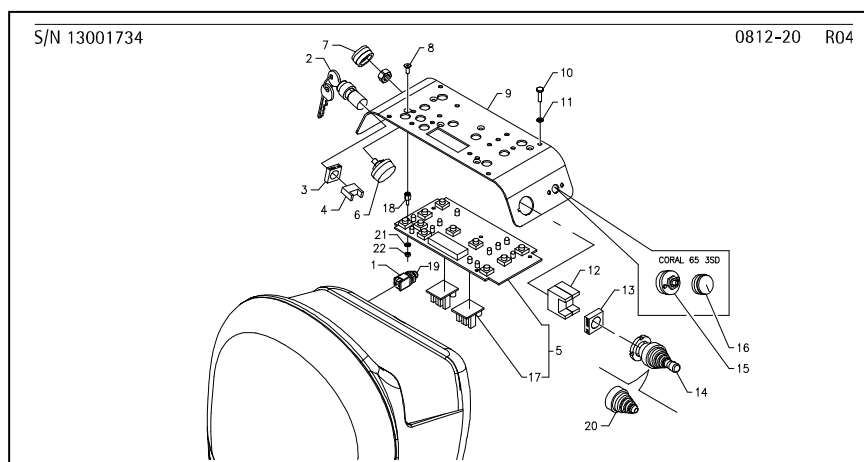

Take off:

pos. 18 No. 6 63705003 coupler check card

Add:

pos. 22 No. 6 60210304 nut M3 nylon

pos. 21 No. 6 60303005 washer 3,2x9x0,8 nylon

pos. 18 No. 6 63705004 hexagonal spacer

On request the updated tables.

At your disposal for additional information, we remain

with best regards

ADIATEK SRL

Technical dept.

Amore